

**CASE STUDY**

# How System Level Noise in Digital Interfaces can Lead to Spurious Errors in Serial Flash Memory

Paul Hill, Renesas Electronics Corporation

Gordon MacNee, Renesas Electronics Corporation

## Introduction

In the relentless pursuit of higher performance at a system level, Integrated Device Manufacturers (IDMs) have become well versed in developing digital interfaces that are able to operate at high speeds in electrically challenging environments. Standard interfaces, such as SPI and I2C, provide a relatively simple way of interconnecting devices from different suppliers in a way that is reliable and effective. The same is true for other types of interfaces.

The digital domain can be thought of as providing a safe haven for developers looking to build complex systems rapidly using 'standard' technologies. Indeed, the embedded industry is largely dependent on standards-based interfaces that 'just work', as they provide the framework for innovation. When they don't 'just work', it can lead to confusion, particularly if the cause of a fault is misinterpreted. Any confusion would be understandable, given that the interfaces are developed to be robust and reliable when applied in accordance with the specification. The fact that the underlying physical interface is fixed in silicon would also provide reassurance.

## System noise, in all its forms

Any distortion to a signal can be interpreted as noise and it is probably reasonable to assume that noise is most often apparent in a communications environment; the signal received is not the signal sent. This direct correlation is relatively simple to find, but in some cases the cause and effect are not so easily identified. The challenge is compounded when the fault becomes intermittent.

Today's microcontrollers are designed to deliver reliable operation with minimal configuration. In the case of a serial interface this may include defaulting to high drive currents on the I/O pins in order to combat the influence of long PCB tracks or high capacitive loads. In some instances, this can result in over-driving an interface which, in turn, can lead to derivative effects that are interpreted as errors or faults.

As an example, serial flash memory devices offer a number of advanced features that ensure reliable operation and allow the device to be interrogated. This can include noise filters, advanced adaptive programming, and erase algorithms that manage cell margins. Some manufacturers also include ECC in the storage elements saving additional meta data with each write operation to allow single or multi bit errors to be detected and corrected, but this ECC fix will not help when noise corrupts the basic message transaction on the communication interface bus.

Noise on the SPI interface can be misinterpreted as additional clock pulses. As SPI is a clock driven interface this would have repercussions such as commands being ignored, data being misinterpreted, wrong commands being used, etc. However, noise also carries energy and in some cases this energy can itself introduce errors in the operation of a device.

# CASE STUDY

## Charge pumps and overshoot

In most cases, some overshoot or undershoot in a signal can be tolerated by digital interfaces. It should not be forgotten, however, that the energy under the curve is still present and in some circuits this can be disruptive.

A case in point is the charge pump circuitry in serial flash memory. If the SPI bus signals contain significant noise, there is a chance that the energy in that signal can propagate through to the charge pump and disrupt its operation.

The charge pump in flash memory is a critical function, as it provides the power needed to change the bias of a memory cell and, effectively, store a logical 1 or 0. The write/erase process is a crucial time in the operation of flash memory, any disruption to the charge pump during this time can cause write or erase errors and, while these errors may be detected, there is a chance that they will not be apparent.

An error of this sort can easily be interpreted as a fault in the flash memory device. The fact that flash memory has a finite number of read and write cycles guaranteed by the manufacturer is well understood by embedded designers, but what is perhaps not so well understood is the importance of providing a clean interface devoid of too much overshoot or undershoot.

As an example, consider the image in Figure 1. It shows healthy cell margins for six flash devices. Two distinct patterns emerge between cells programmed with data representing logical 1 (2V to 5V) and 0 (>6v). By comparison, the image in Figure 2 shows memory cell margin for three flash devices that have suffered data corruption caused by overshoot and undershoot on the control lines.

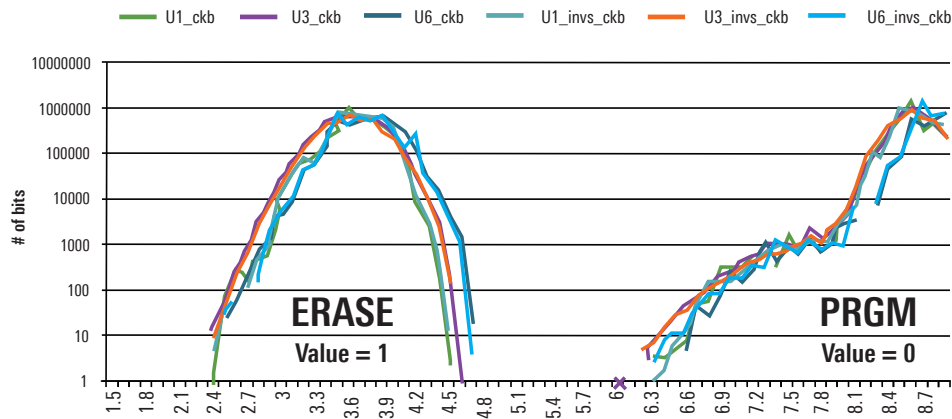


Figure 1: This image shows good cell margin separation data for flash memory that has been programmed and erased.

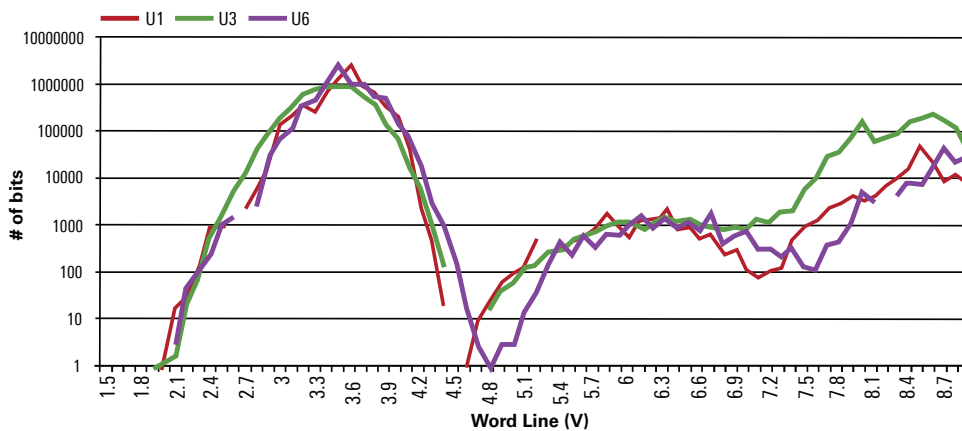


Figure 2: This image shows poor cell margin separation data for flash memory where there has been significant noise present on the SPI lines

Multiple factors can contribute to the noise level, such as frequency of operation, amplitude of the signal, MCU drive levels, and the energy contained in the noise spikes. PCB design and cross talk between signals may also be contributing factors.

## CASE STUDY

The data in Figure 2 shows the effects of excessive overshoot and undershoot on the serial interface. Figure 3 below shows a representation of what this overshoot would look like in a real application.

The result of this noise was erroneous device operation, which showed up as errors in the serial flash memory stored values. Initially, the true impact of the errors was missed, as polling the STATUS register on a less frequent basis reported fewer errors, leading the designer to make incorrect assumptions on the root cause of the failure.

Although this fault appeared as a memory failure, the root cause was not with the flash devices. This was discovered by Renesas engineers by probing the SPI signals and identifying the system noise present. While the noise could be partly attributed to an impedance mismatch present on the PCB track between the MCU and flash memory, it wasn't the full story. The source of the noise was actually the MCU interface, which defaults to a high drive level at power-up. The excessive drive was enough to cause overshoot and undershoot on the SPI lines, which in some cases can be misinterpreted as signal transitions, leading to read or write errors. However, in this instance it was found that the overshoot held sufficient energy to disrupt the flash charge pump, which was in turn causing the errors.

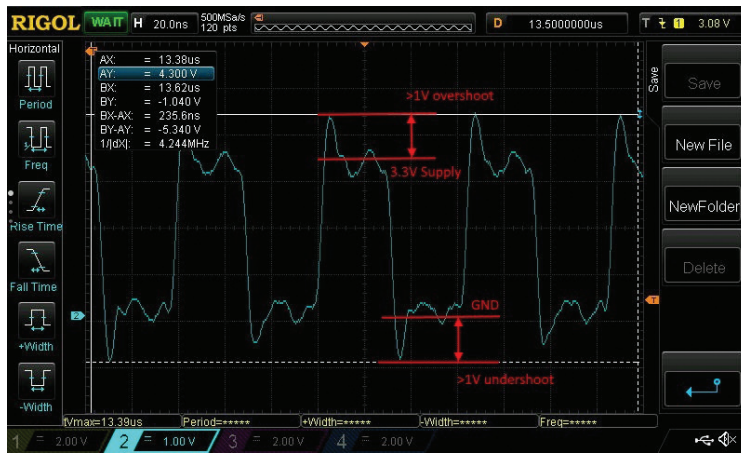


Figure 3: This trace image clearly shows the overshoot and undershoot present on the SPI lines was resulting in a peak-to-peak voltage of 5.65V, which exceeds the absolute maximum value documented in the flash memory specification.

In the customer's design, the microcontroller being used provided a configurable drive current for its I/O, which defaults to HIGH at start-up. As the application code did not modify this level during initialization it remained high in normal operation. The impact of this may not be apparent for other devices on the SPI bus, as digital interfaces are typically designed to be robust. The sensitive nature of flash memory, the need to operate at much higher frequencies, and in particular, the operation of the charge pump, made the memory susceptible to overshoot/undershoot. This led to erroneous operation that was initially misinterpreted as a fault in the flash memory device.

Reducing the drive current, through firmware, reduced the overshoot and undershoot to effectively zero (Figure 4), and in turn resulted in error-free operation of the flash memory.

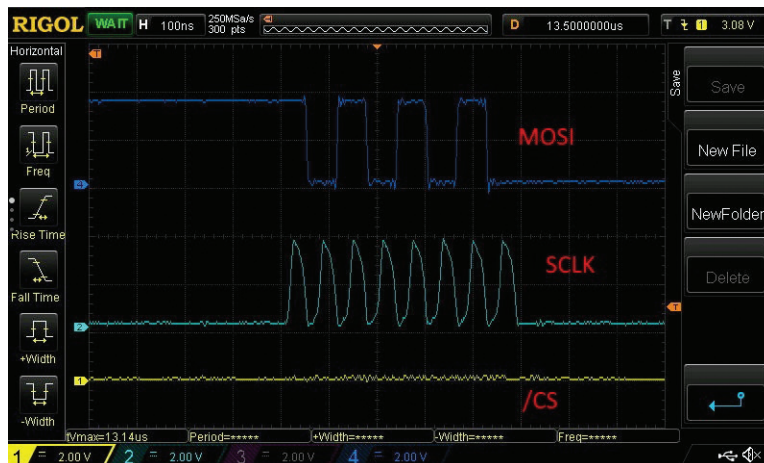


Figure 4: With no overshoot apparent, the serial flash memory's charge pump was able to operate correctly and provide reliable functionality

## CASE STUDY

The nature of the fault showed that the flash device was making every effort to compensate for the effect of the error, which was the excessive system noise on the SPI interface. Perhaps the most significant point here is that the cause was actually a design feature of the MCU used, which defaulted to an operating mode that, in most situations, would be entirely acceptable. The combination of a high drive output and imperfect PCB inductance created a condition that resulted in intermittent failure. Reducing the drive output on the MCU, through a simple firmware change, solved the issue.

This highlights the real lesson here, that what may appear as a genuine component failure may actually be an oversight in the design. Replacing the memory devices would have been a natural response to what was initially believed to be the fault, but through a strong working relationship between customer and supplier, as well as hardware and software engineering teams, the actual cause was found and the right solution applied. The result was a significantly better design, higher system performance and greater reliability.

### Conclusion

System noise can easily be dismissed when there is no apparent impact. Intermittent errors are particularly difficult to locate under optimal conditions, but when the errors are misinterpreted it makes the challenge even harder.

Overshoot is possibly the least apparent form of system noise, but as explained here, its impact can be significant. Flash memory is a reliable technology but one that depends on a carefully designed interface. Excessive noise on the serial interface has the potential to propagate through to the charge pump circuitry, detracting from the operation of the programming and erase circuitry. This results in unforeseen characteristics that can easily be interpreted as a fault on the device itself showing up as memory cell faults, as well as inconsistent or unreliable programming and erase operations.

In this instance, replacing the flash memory and assuming the issue was solved could have resulted in products going to market that were likely to fail at some point. Instead, the designer was able to improve programming and erase consistency by a significant factor, with effective endurance jumping from an unacceptable ~20K cycles before errors were detected to over 2.5M cycles with no errors and no requirement for supplementary error detection and correction routines.

The level of configurability offered by modern microcontrollers can be seen as both a help and a hindrance; the fact that the drive current is configurable was possibly the cause for the overshoot in this example. However, being able to reduce the drive strength was also effective in solving the problem.



Renesas Electronics America Inc. | [renesas.com](https://www.renesas.com)  
1001 Murphy Ranch Road, Milpitas, CA 95035 | Phone: 1-888-468-3774

© 2022 Renesas Electronics America Inc. (REA). All rights reserved. All trademarks are the property of their respective owners. REA believes the information herein was accurate when given but assumes no risk as to its quality or use. All information is provided as-is without warranties of any kind, whether express, implied, statutory, or arising from course of dealing, usage, or trade practice, including without limitation as to merchantability, fitness for a particular purpose, or non-infringement. REA shall not be liable for any direct, indirect, special, consequential, incidental, or other damages whatsoever, arising from use of or reliance on the information herein, if advised of the possibility of such damages. REA reserves the right, without notice, to discontinue products or make changes to the design or specifications of its products or other information herein. All contents are protected by U.S. and international copyright laws. Except as specifically permitted herein, no portion of this material may be reproduced in any form, or by any means, without prior written permission from Renesas Electronics America Inc. Visitors or users are not permitted to modify, distribute, publish, transmit or create derivative works of any of this material for any public or commercial purposes.